

Original Research Article

Analysis of Critical Risk Factors in Five Iconic Major Incidents Using Tripod Beta Analysis Method

ABSTRACT

This study determined the critical risk factors that influence the risk of major accidents in [the](#) petroleum and chemical industries. [The retrospective study](#)~~It is a retrospective study which~~ assessed five iconic accidents using the tripod beta analysis methodology. Literatures on the five iconic accidents were reviewed, [and](#) the immediate causes of the accidents, preconditions, [and](#) latent failures were analysed using a focused group of process safety professionals. These failures were aggregated into critical risk factors for these major accidents. The findings of this study revealed empirically that there are broadly five critical risk factors that influence the risk of major accidents: (i) design flaws, (ii) site process safety management, (iii) barrier management / control, (iv) operating procedures and (v) process safety culture. These findings highlight the need to develop a proactive risk assessment tool with the capability to check the health of [safety-critical](#)~~safety-critical~~ barriers in an operating plant. The result also flagged the dangerous accumulation of the risk of major [accidents](#)~~accident~~ from impairment of these [safety-critical](#)~~safety-critical~~ barriers, to enable proper informed intervention steps to reduce the risk of major accidents. The need for [the](#) use of Tripod Beta as a tool in accident causation analysis is recommended.

Keywords: Petroleum and chemical industries, Critical Risk Factors, Major Accidents

1.0 INTRODUCTION

Globally, major process safety accidents have [increased](#)~~been on the increase~~ in chemicals and petroleum facilities and operations [1]. Even though these major process safety accidents do not occur frequently, their consequences are high in terms of reputation damage, environmental degradation, multiple fatalities, [and](#) the total loss of [assets](#)~~asset~~ [21] and potential loss of license to operate. Causally, [complex causal patterns usually characterize major accidents](#)~~major accidents are usually characterized by complex causal patterns,~~ and it is usually

Comment [MOU1]: references are not sorted by number, please fix them from the first to the last order

very difficult to attribute the causes to one factor [21]. According to [2], the causes of these incidents are usually traceable to many failures in technology, ~~humans~~ human, management systems, external circumstances, and sometimes natural phenomena. Understanding the causes of accidents plays a major role in learning from these accidents and helps in developing prevention and control strategies. In other words, ~~the~~ analysis of accidents is an essential stage in ~~adopting~~ the adoption of adequate measures to prevent ~~the occurrence of~~ similar accidents. Therefore, it is important to gain a detailed understanding of all causes contributing to the occurrence of major accidents, so that appropriate and adequate controls can be put in place. Usually, the analysis of major accidents focuses on investigating the causal factors and system failures, ~~to prevent with a view to preventing~~ similar incidents in ~~the~~ future or ~~mitigate~~ mitigating their consequences [14]. A number of studies has considered different accident analysis methodologies. These studies revealed that the Tripod Beta methodology is more efficient for the analysis of accidents, compared with the other methods [14];[16]. The methodology in a systematic way, deals with the analysis of the reasons for failure of the barrier and development of actions addressing the underlying causes

1.1 AIM

This paper/study aimed to determine the critical factors ~~influencing~~ that influence the risk of major accidents in ~~the~~ petroleum and chemical industries.

1.2 OBJECTIVES

1. Analysis ~~of~~ five iconic major accidents using Tripod Beta Methodology
2. From the analysis, ~~the~~ determination of the critical factors that influence the risk of major accidents in oil and gas and chemical industries

2.0 MATERIAL AND METHODS

This is a retrospective study that analysed five iconic major accidents in the petroleum and chemicals industry using the Tripod Beta Analysis methodology. Previously published articles and literatures on the five iconic accidents were reviewed, the immediate causes of the accidents, preconditions, latent failures were analysed and these failures were aggregated into critical risk factors for these accidents. A focused group of five process safety professionals and a "Tripodian" (a trained Tripod Beta practitioner) was used for the Tripod Beta analysis and input into the Tripod Beta software.

The following steps were used in the analysis:

- a) Review of each of the five iconic accidents based on the published articles
- b) Analysis of the immediate causes, pre-conditions and latent failures
- c) Use of the Tripod Beta software to build the Tripod Beta Tree
- d) Analysis of the risk factors by mapping the Tripod Basic Risk Factors to the accidents

Table 1: List of 5 Iconic Major Accidents

Year	Name	Product	Type of Incident
------	------	---------	------------------

1984	Bhopal Methyl Isocyanate Release	Chemicals	Fire and explosion
1988	Piper-alpha Disaster	Oil and Gas	Fire and Explosion
2005	Buncefield incident	Petrol	Fire and Explosion
2005	BP Texas City Refinery Explosion	Gas	Fire and Explosion
2010	Macondo Deep Water Incident	Oil	Fire and Explosion

2.1 Tripod Beta Methodology Framework

This Tripod Beta theory is based on the premise that accidents happen because controls fail and the underlying causes of controls failing are latent failures. These latent failures are present long before an accident occurs and if these failures can be identified and corrective actions taken to remove them, the risk of accidents will be reduced. The immediate causes like unsafe acts considered in Tripod Beta do not occur separately, they are rather affected by a series of external factors or preconditions, originating themselves from a series of latent problems. These latent problems, in turn, originate from decisions or actions performed by designers or operators of the facilities, usually considered as human errors or error enforcing conditions. The immediate problems are those which are in close contact with incidence of an event. The pre-conditions are the systemic, mental, psychological, positional, and/or environmental states which directly lead to superficial errors [5]. The latent problems are abnormal conditions creating the preconditions and leading to the immediate causes. The latent problems which have the potential for creating events may be hidden for long periods of time and display themselves only under the conditions of the creation of normal suitable conditions such as combination with some preventive factors, immediate causes, technical errors, or the unusual states of the system [5].

The Tripod Beta methodology is designed to help an accident investigators to analyze the causes of an incident or accident in conjunction with conducting the investigation. This helps to direct the investigation, as the investigator will be able to see where more information is needed regarding what happened, or how or why the incident occurred [6]. The result from Tripod Beta analysis is a tripod tree that basically shows what happened, how did it happen and why did it happen.

2.2 Brief Description of the 5 Iconic Accidents

A brief description of the incidents is shown in Table 2.

Table 2: Brief description of 5 iconic major accidents

Description	Bhopal	Piper-Alpha	BP Texas Refinery	Buncefield	Macondo
Date of accident	3 December 1984	6 July 1988	23 March 2005	10 December 2005	20 April 2010
Product	Chemicals (Methyl Isocyanate)	Oil and gas	Gas	Petrol	Oil and gas

Damages/consequences	2,000 fatalities; 100,000 injuries; significant damage to livestock	167 fatalities; total destruction of the platforms	15 fatalities; 180 injuries	Extensive damage of the tank farm	11 fatalities; 17 injuries, damage of drilling rig, extensive environmental pollution
Summary of the incident	40 metric tons of methyl isocyanate (MIC) accidentally released into the atmosphere from an exothermic reaction as a result of release of about 2,000 litres of water into the MIC tank. There were a lot of defects identified during the investigation. For example, the facility emergency response capability was poor, coupled with lack of awareness by local communities of the hazardous nature of the Bhopal plant product[18]	There was a release of a large quantity of condensate and gas from an incorrectly installed blind flange. The released condensate picked up ignition resulting into an initial fire and explosion. Other risers to the platform failed under the initial explosion and the resulting release of their inventories, increased the size of the inferno. The incident investigation also revealed the consideration for operation output over safety, due to lack of stop work authority by the supervisor. Poor permit-to-work system was also implicated in the incident[18]	During the start-up of an isomerization unit, the raffinate splitter tower overfilled and consequently caused the pressure relief devices on the tower to open. The opening of the safety valves resulted in overfilling of the blowdown stack and release of flammable liquid from a blowdown stack. The released flammable liquid found an ignition source from near office trailers located close to the blowdown drum and this led to an explosion and fire[8; 23]	Oil storage tank overfilled with petrol, resulting into large quantities of petrol overflowing from the top of the tank. The overflowing petrol formed a vapour cloud, found an ignition source and this resulted in a massive explosion and a fire that lasted for days[7; 9]	Due to a well "kick", during a well temporary abandonment operation, hydrocarbon flowed to the rig floor (called "blowout") when the drilling fluid column was removed. Even though a safety critical device located at the sea floor sealed the well temporarily, this could not stop the hydrocarbon from travelling up to the rig floor. Due to a number of safety-critical failures in the system, hydrocarbons rained down onto the rig floor, found an ignition source and fire /explosion [24]

2.3 Findings

The Tripod-Beta Tree of the five iconic accidents are shown in Figures 1, 2, 3, 4 and 5. The analysis of the failures and the mapping of the failures to the relevant Tripod Beta "Basic Risk Factors" in each of the five major accidents is shown in Table 3.

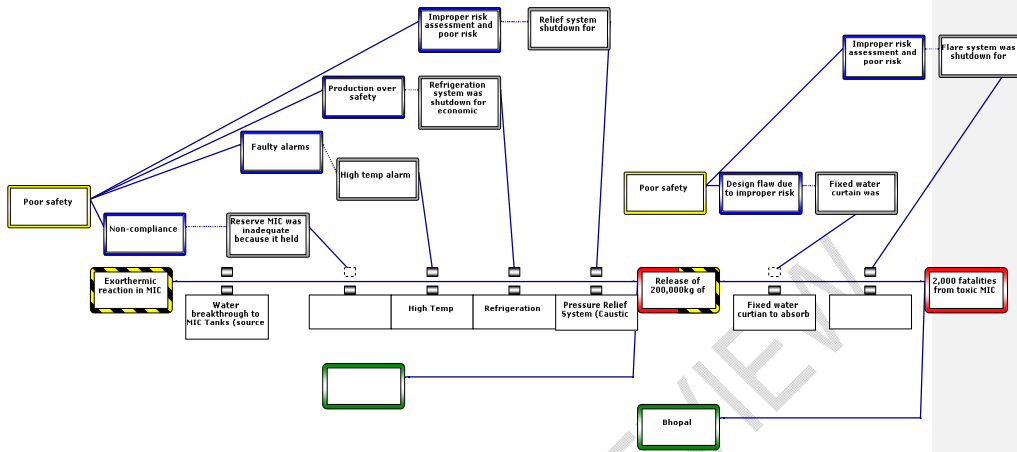


Figure1: Tripod Beta Tree for Bhopal Incident

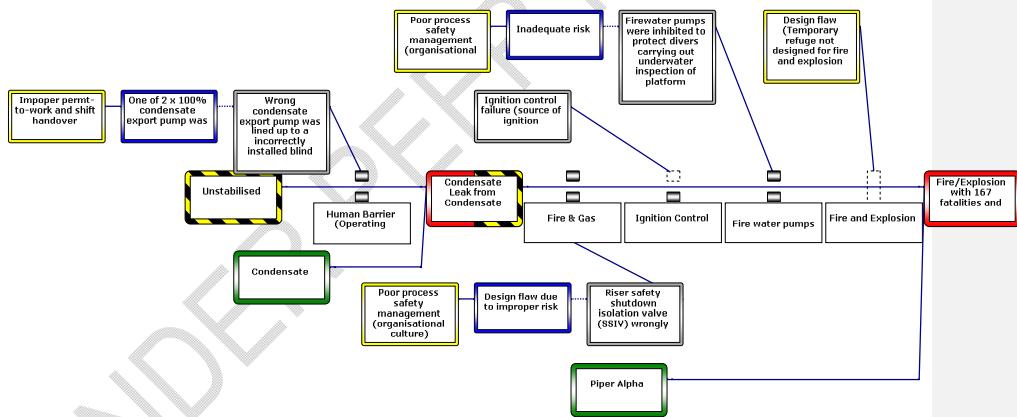


Figure 2: Tripod Beta Tree for Piper-Alpha Incident

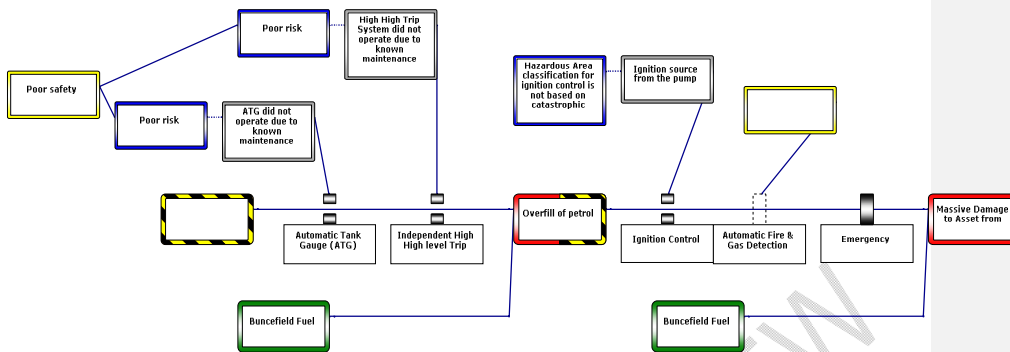


Figure3: Tripod Beta Tree for Buncefield Incident

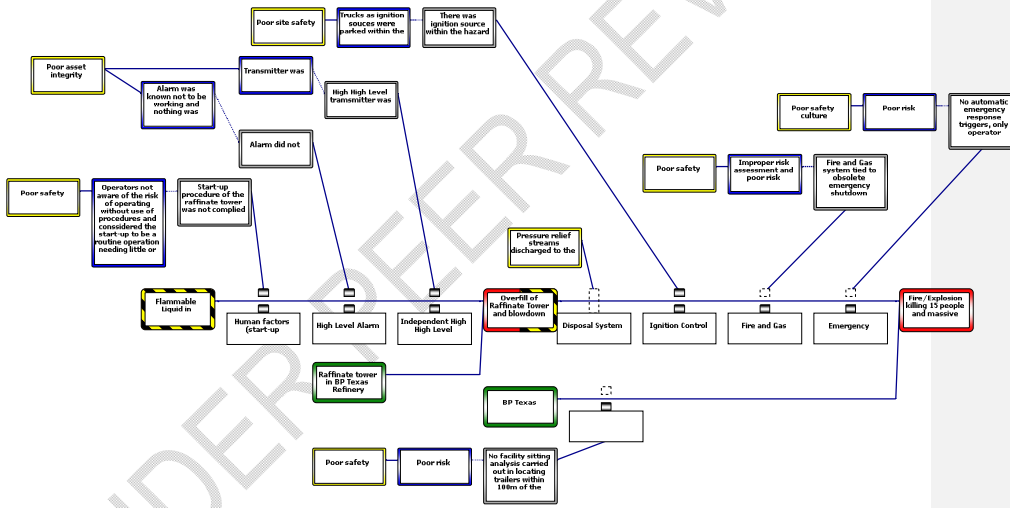


Figure 4: Tripod Beta Tree for BP Texas Refinery Incident

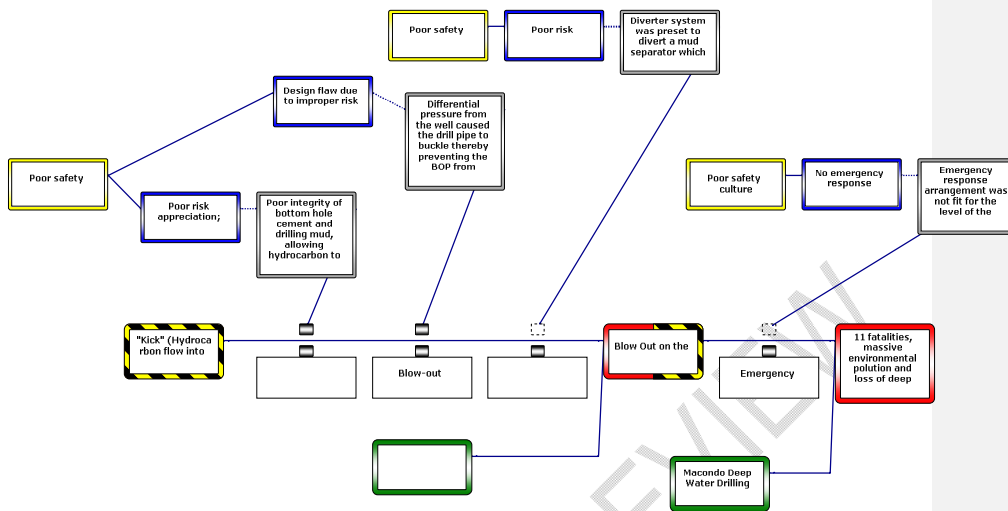


Figure 5: Tripod Beta Tree for Macondo Incident

For example, on the Bhopal incident, Barrier 1 preventing water breakthrough into the MIC tanks failed (source of the water is unknown). MIC tank as Barrier 2 failed due to the fact that it could not quench the exothermic reaction because it was containing some inventories. The pre-condition for this Barrier 2 failure is non-compliance with procedures on inventory management in MIC tanks and this is traceable to poor site safety management. Barrier 3 failure was the failure of the high temperature shutdown system. The high temperature alarm was known to be faulty but it was ignored, again traceable to poor site safety management. Barrier 4 failure was the refrigerant system installed to handle the heat from the exothermic reaction was shutdown for economic reasons as the company justified production over safety considerations, again traceable to poor site safety management. Pressure relief system failure as Barrier 5 failed because it was shutdown for maintenance and no proper risk assessment was carried out to mitigate the risk of the shutdown of the pressure relief system, this is again traceable to poor site safety management. On the consequence mitigation side, Barrier 6 was the fixed water curtains which were provided to absorb MIC vapour. However, it was insufficient to absorb the vapour due to inherent design flaws. Barrier 7 is the flare system provided to incinerate the MIC vapour but this barrier was shutdown for repairs and no proper risk assessment was carried out to mitigate the risk, again traceable to poor site safety management.

Table 3: Mapping of the relevant Tripod Beta “Basic Risk Factors” in each of the five major accidents

BRFs	Bhopal	Piper-Alpha	Buncefield	BP Texas Refinery	Macondo
Design (DE)					
Hardware (HW)	Improper design of reserve MIC tank	Wrong positioning of riser safety shutdown	Poor design - automatic fire and gas detection	Improper design of relief system Improper	Poor integrity of bottom hole cement and drilling mud

	Improper design of fixed water curtain to absorb MIC vapour	isolation valve (SSIV) Improper design of temporary refuge for fire and explosion protection	system not provided on site	design of emergency response system	Design flaw – differential pressure buckled blow out preventer (BOP) Inadequate mud diverter system Mud separator on drilling floor not fit for purpose (under-designed)
Maintenance Management (MM)	Inventory in MIC tank (degraded barrier) Faulty high temp alarm on MIC tank MIC refrigeration system shutdown MIC relief system shutdown for maintenance Flare system shutdown for repair	Use of condensate evacuation pump (degraded barrier) Inhibited firewater pumps to protect divers without interim mitigation measures	Automatic tank gauging system failed due to known maintenance issues Independent high-high level trip failed due to known maintenance issues	Faulty high level alarm on the raffinate tower Independent high level trip inoperable Inoperable shutdown system (fire and gas systems tied to obsolete shutdown system)	Physical barriers on well not tested for functionality, availability and reliability
House keeping (HK) Error-enforcing condition (EC)					
Procedures (PR)	Non-compliance with reserve MIC tank inventory management procedure	Wrong lining of condensate evacuation pump Improper permit-to-work management		Non-compliance with obsolete start-up procedure Non-compliance with access control procedure (ignition source in hazardous area)	Failure to divert well fluid to a safe location on the drilling floor
Training (TR)					Incompetence (many weak


					signals on disaster not picked up
Communication (CO)		Improper shift handover communication			
Incompatible goals (IG)					
Organisation (OR)	Production over safety consideration (refrigeration system shutdown for economic reasons) Poor site process safety management (inadequate risk assessment for impaired barriers; previous safety audit findings not implemented)	Poor site process safety management (inadequate risk assessments; previous safety audit findings recommending dedicated firefighting system to protect platform not implemented)	Poor site safety management (known failed barriers not addressed)	Poor site process safety management (ignition source in hazardous area; poor risk appreciation; previous safety audit findings not implemented)	Poor site process safety management (very poor risk appreciation and risk assessment; ineffective barrier management)
Defenses (DF)	Insufficient protection of people and environment from consequences of MIC hazard release (no emergency response preparedness for Bhopal community)	Insufficient protection of people from consequences of major hazard release on site (temporary refuge not designed for fire and explosion protection)		Improper design of emergency response system (no automatic emergency response system)	Emergency response arrangement not fit for purpose (not understood and tested)

Further analysis of the Tripod Beta Basis Risk Factors by the Process Safety Focus Group re-classified the risk factors into the following categories. The mapping of the Tripod Beta BRFs to Critical Risk Factors is shown in Table 4.

- a) Design flaws (design integrity)
- b) Site process safety management (inadequate risk assessment including cumulative risk, poor permit to work management, management of changes, incompetence)

- c) Barrier management/control (ineffective management of impaired and down-graded barriers, overrides /inhibits)
- d) Plant operating procedures (no-compliance with procedures, obsolete procedures)
- e) Process safety culture (Audits/reviews findings not implemented, poor risk appreciation)

Table 4: Mapping of the Tripod Beta BRFs to Critical Risk Factors

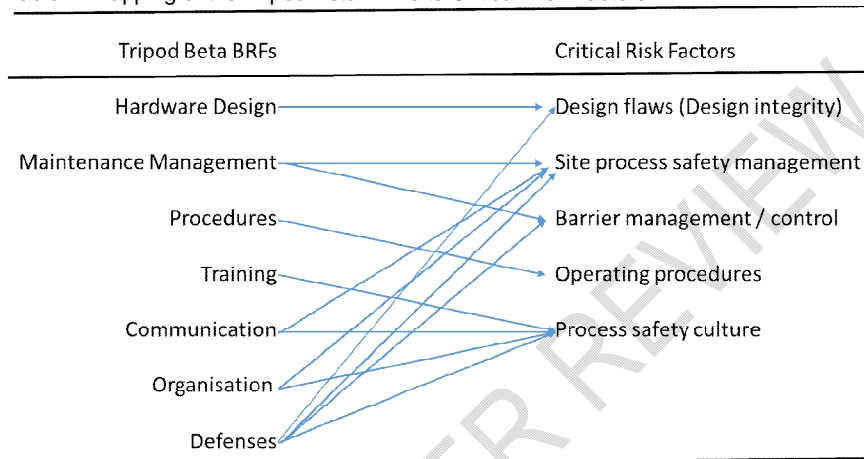

3. DISCUSSION

From Tables 3, five Tripod Beta Basic Risk Factors (BRFs) have the highest occurrence in the five iconic accident reports studied: Hardware (HW), Maintenance Management (MM), Procedures (PR), Organization (OR) and Defenses (DF). Further analysis of the dominating Tripod Beta BRFs re-classified the factors into five critical risk factors – design flaws, site process safety management, barrier management / control, operating procedures and process safety culture. Design flaws are to do with poor/improper design and integrity of the facility and this aligns with the opinion of [4] that design flaw is one of the major accidents causal factors. Site process safety management in the main, relates to risk assessments and mitigation planning to ensure that there are adequate measures to protect the release of major hazards and limit consequences when the controls are lost. This agrees with the view of [10] that risk assessment is at the heart of major accident prevention. Barrier management and control relates to all the activities required to ensure that barriers and protection layers are effective and fulfils the functionality at all times. This aligns with the view of [11] that effective barrier management is fundamental in preventing major accidents and that inadequate barrier management has been the main cause of major accidents in the oil and gas industry [12;13]. According to [15], maintenance management plays a vital role in reducing the risk of major accidents and failure or weakening of barriers is a major cause of accidents. [1] supported this view by stating that the influence of various factors such as maintenance backlog, inhibits/bypasses, deferrals, overdue preventive maintenance, management of change ~~programs~~program, ~~permit-to-work~~permit to work practices, conflicting work orders increase the risk of major accidents. According to [20], 30% of major accidents in the oil and gas industry is due to inadequate maintenance. Operating procedures have to do with compliance with the procedures or even obsolescence of the

procedures as a critical risk factor in major accidents. This aligns with the opinion of [20] that the major reason why offshore accidents keep occurring is due to operational discipline and compliance with plant operating procedures. Major accident risk is also reduced by proper communication within the teams especially with respect to shift handovers. This aligns with the view of [19] that poor communication contributed to the organizational failure in BP Deep Water accident of 2010. Process safety culture represents all aspects of the values, norms, attitudes, perceptions, beliefs, actions and assumptions of any organization related to process safety [17]. The view that process safety culture as one of the critical risk factors in major accident causation aligns with the view of [22;20] that (process) safety culture is one of the main causes of accidents in major hazard organizations

4. CONCLUSION

The aim of the study was to analyze five iconic accidents from the perspective of the risk factors and gather empirical evidence on the factors that affect the risk of major accidents. The study was conducted in three steps. (1) Review of the major accident reports was carried out. (2) Analysis of the major accidents using Tripod Beta methodology (3) Re-classification of the risk factors from Tripod Beta analysis. Through this study, five risk factors were identified: design flaws, site process safety management (risk assessment), barrier management / control, operating procedures and process safety culture. These findings highlight the need to develop a proactive risk assessment tool with the capability to check the health of safety critical barriers in an operating plant. The result also flagged the dangerous accumulation of the risk of major accident from impairment of these [essential barriers of safety](#)~~safety-critical barriers~~, to enable proper informed intervention steps to reduce the risk of major accidents. The need for the use of Tripod Beta as a tool in accident causation analysis is recommended.

6. CONSENT

As per University requirement, a written consent was sought and obtained from respondents and subsequently preserved by the Arthurs.

7. REFERENCES

1. Behie, S. W., Halim, S. Z., Efaw, B., O'Connor, T. M., & Quddus, N. Guidance to improve the effectiveness of process safety management systems in operating facilities. *Journal of Loss Prevention in the Process Industries*, 2020. 68(June), 104257. <https://doi.org/10.1016/j.jlp.2020.104257>
2. Bubbico, R., Lee, S., Moscati, D., & Paltrinieri, N. (2020). Dynamic assessment of safety barriers preventing escalation in offshore Oil&Gas. *Safety Science*, 2020. 121, 319–330. <https://doi.org/10.1016/j.ssci.2019.09.011>
3. Cullen, T. H. L. Piper Alfa. In *The Public Enquiry into the Piper Alpha Disaster*. 1990
4. Darbra, R. M., Palacios, A., & Casal, J. Domino effect in chemical accidents: Main features and accident sequences. *Journal of Hazardous Materials*, 2010. 183(1–3), 565–573. <https://doi.org/10.1016/j.jhazmat.2010.07.061>
5. Ebrahemzadih, M., Giahi, O., & Foroginasab, F. Analysis of traffic accidents leading to death using tripod beta method in Yazd, Iran. *Promet - Traffic - Traffico*, 2016. 28(3), 291–297. <https://doi.org/10.7307/ptt.v28i3.1725>
6. Fu, G., Xie, X., Jia, Q., Li, Z., Chen, P., & Ge, Y. The development history of accident causation models in the past 100 years: 24Model, a more modern accident causation model.

Comment [MOU2]: please correct the references according to the journal guide

- Process Safety and Environmental Protection, 2020. 134(November 2019), 47–82.
<https://doi.org/10.1016/j.psep.2019.11.027>
7. Hailwood, M., Gawlowski, M., Schalau, B., & Schönbucher, A. Conclusions drawn from the Buncefield and Naples incidents regarding the utilization of consequence models. *Chemical Engineering and Technology*, 2009. 32(2), 207–231.
<https://doi.org/10.1002/ceat.200800595>
8. Hopkins, A. Failure to learn : the BP Texas City refinery disaster. CCH. 2008
9. HSE. Buncefield: Why did it happen? Control of Major Accident Hazards, 2011.
www.hse.gov.uk/comah/buncefield/buncefield-report.pdf
10. ISHOLA, A. Advanced Safety Methodology for Risk Management of Petroleum Refinery Operations Ademola Ishola A thesis submitted in partial fulfilment of the requirements of Liverpool John Moores University for the degree of Doctor of Philosophy September 2017. September.
11. Johansen, I. L., & Rausand, M. Barrier management in the offshore oil and gas industry. *Journal of Loss Prevention in the Process Industries*, 2015. 34, 49–55.
<https://doi.org/10.1016/j.jlp.2015.01.023>
12. Jonassen, Ø., & Sjølie, E. Barrier management in operation for the rig industry - A joint industry project. *Offshore Technology Conference Asia 2016, OTCA 2016, March*, 388–395.
<https://doi.org/10.4043/26819-ms>
13. Zongsvik, T., Almklov, P., Haavik, T., Haugen, S., Vinnem, J. E., & Schiefloe, P. M. Decisions and decision support for major accident prevention in the process industries. *Journal of Loss Prevention in the Process Industries*, 2015. 35(1), 85–94.
<https://doi.org/10.1016/j.jlp.2015.03.018>
14. Kontogiannis, T., Leopoulos, V., & Marmaras, N. A comparison of accident analysis techniques for safety-critical man-machine systems. *International Journal of Industrial Ergonomics*, 2000. 25(4), 327–347. [https://doi.org/10.1016/S0169-8141\(99\)00022-0](https://doi.org/10.1016/S0169-8141(99)00022-0)
15. Lauridsen, O., Lootz, E., Husebo, T., & Ersdal, G. Barrier management and the interaction between technical, operational and organisational barrier elements. *Society of Petroleum Engineers - SPE International Conference and Exhibition on Health, Safety, Security, Environment, and Social Responsibility*, 2016. <https://doi.org/10.2118/179364-ms>
16. Lee, G. T., & Shah, M. Z. The Application of the Tripod Beta Approach in Assessing the Effectiveness of the Port Security Measures in Compliance to the International Ship and Port Facility Security Code. *American Scientific Research Journal for Engineering, Technology, and Sciences*, 2017. 37(1), 82–98.
http://asrjetsjournal.org/index.php/American_Scientific_Journal/article/download/3354/1285%0Ahttps://ieng.org/031-586-241-204-801
17. Martyka, J., & Lebecki, K. Safety culture in high-risk industries. *International Journal of Occupational Safety and Ergonomics*, 2014 20(4), 561–572.
<https://doi.org/10.1080/10803548.2014.11077076>
18. Ness, A. Lessons learned from recent process safety incidents. *Chemical Engineering Progress*, 2015. 111(3), 23–29.
19. Norazahar, N., Khan, F., Veitch, B., & MacKinnon, S. Human and organizational factors assessment of the evacuation operation of BP Deepwater Horizon accident. *Safety Science*, 2014. 70, 41–49. <https://doi.org/10.1016/j.ssci.2014.05.002>
20. Nwankwo, C. D., Arewa, A. O., Theophilus, S. C., & Esenowo, V. N. Analysis of accidents caused by human factors in the oil and gas industry using the HFACS-OGI framework. *International Journal of Occupational Safety and Ergonomics*, 2022. 28(3), 1642–1654. <https://doi.org/10.1080/10803548.2021.1916238>
21. Okoh, P., & Haugen, S. A study of maintenance-related major accident cases in the 21st century. *Process Safety and Environmental Protection*, 2014 .92(4), 346–356.
<https://doi.org/10.1016/j.psep.2014.03.001>
22. SOLMAZ, M. S., ERDEM, P., & BARIŞ, G. The Effects of Safety Culture on Occupational Accidents: An explanatory study in Container Terminals of Turkey. *International Journal of*

Environment and Geoinformatics, 2020. 7(3), 356–364.

<https://doi.org/10.30897/ijegeo.749735>

23. US Chemical Safety and Investigation Board. Investigation Report Refinery Explosion and Fire BP Texas City. Investigation Report, 2007. 1–341. <https://www.csb.gov/bp-america-refinery-explosion/>

24. US Chemical Safety Hazard and Investigation Board. US Chemical Safety and Hazard Investigation Board Investigation Report Volume 1. Explosion and Fire at the Macondo Well, 1(Investigatin Report), 2010. 1–37.

UNDER PEER REVIEW